

---

# **LUDLUM MODEL 3 SURVEY METER**


**February 2010  
Serial Number 239543 and Succeeding  
Serial Numbers**



**LUDLUM MEASUREMENTS, INC.**  
501 OAK STREET, P.O. BOX 810  
SWEETWATER, TEXAS 79556  
325-235-5494, FAX: 325-235-4672

---

Model 3 Survey Meter

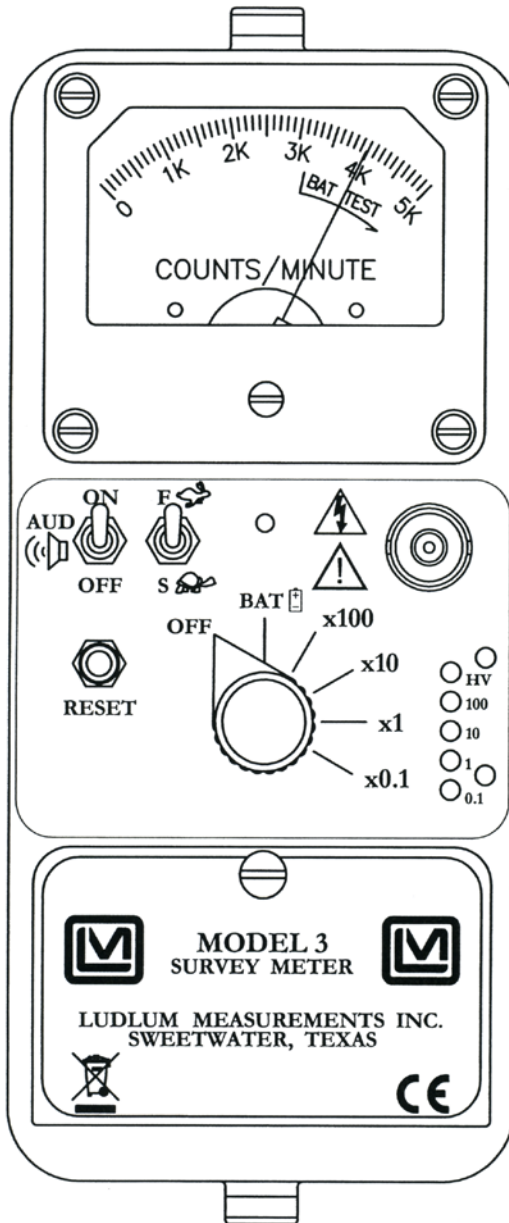

## Table of Contents

---

<i>Introduction</i>	1
<i>Getting Started</i>	2
Unpacking and Repacking	2
Battery Installation	3
Connecting a Detector to the Instrument	3
Battery Test	4
Instrument Test	4
Reading the Meter Face Dial	4
Operational Check	9
<i>Specifications</i>	9
<i>Identification of Controls and Functions</i>	11
<i>Safety Considerations</i>	13
Environmental Conditions for Normal Use	13
Warning Markings and Symbols	14
Cleaning and Maintenance Precautions	15
<i>Calibration and Maintenance</i>	16
Calibration	16
Exposure Rate Calibration	16
CPM Calibration	18

## *Model 3 Survey Meter*

---

Establishing an Operating Point	19
Maintenance	21
Recalibration	21
Batteries	22
<i>Troubleshooting</i>	<i>23</i>
Troubleshooting Electronics which utilize a	
GM Detector or Scintillator	23
Troubleshooting GM Detectors	27
Troubleshooting Scintillators	27
<i>Technical Theory of Operation</i>	<i>28</i>
Low Voltage Supply	28
High Voltage Supply	28
Detector Input	28
Amplifier	28
Discriminator	29
Audio	29
Scale Ranging	29
Meter Drive	29
Meter Reset	30
Fast/Slow Time Constant	30
<i>Recycling</i>	<i>30</i>
<i>Parts List</i>	<i>32</i>
Model 3 Survey Meter	32
Main Board, Drawing 464 × 204	32

## *Model 3 Survey Meter*

---

Wiring Diagram, Drawing 464 × 212

35

*Drawings and Diagrams*

37

## **Introduction**

---

The Model 3 is a portable radiation survey instrument with four linear ranges used with exposure rate or cpm (counts per minute) meter dials, or a combination of both exposure rate and count rate (referred to as “combo”) meter face dials. The instrument features a regulated high-voltage power supply, unimorph speaker with audio on-off capability, fast-slow meter response, meter reset button, and a six-position switch for selecting battery check or scale multiples of  $\times 0.1$ ,  $\times 1$ ,  $\times 10$  and  $\times 100$ . Each range multiplier has its own calibration potentiometer. The unit body and meter housing are made of cast aluminum and the can is 0.23 cm (0.090 in.) thick aluminum.

The audio provides a brief “click” for every radiation event detected. It also provides a steady tone to warn the user of a low battery condition. This low-battery warning overrides the position of the AUD ON-OFF switch.

Any Geiger-Mueller (GM) detector offered by Ludlum Measurements will operate with this unit as well as any scintillation type detector. The instrument is typically set at 900 volts for GM tube operation. For special requirements of GM or scintillation detectors, the instrument high voltage may be adjusted from 200 to 1500 volts.

The unit is operated with two “d” cell batteries for operation from  $-20$  to  $50$  °C ( $-4$  to  $122$ °F). For instrument operation below  $0$  °C ( $32$  °F), either very fresh alkaline or rechargeable NiCd batteries should be used.

## **Getting Started**

---

### **UNPACKING AND REPACKING**

Remove the calibration certificate and place it in a secure location. Remove the instrument and accessories (batteries, cable, etc.) and ensure that all of the items listed on the packing list are in the carton. Check individual item serial numbers and ensure calibration certificates match. The Model 3 serial number is located on the front panel below the battery compartment. Most Ludlum Measurements, Inc. detectors have a label on the base or body of the detector for model and serial number identification.

#### **Important!**


If multiple shipments are received, ensure that the detectors and instruments are not interchanged. Each instrument is calibrated to specific detector(s), and is therefore not interchangeable.

To return an instrument for repair or calibration, provide sufficient packing material to prevent damage during shipment. Also, provide appropriate warning labels to ensure careful handling. Include detector(s) and related cable(s) for calibration. Include brief information as to the reason for return, as well as return shipping instructions:

- return shipping address
- customer name or contact
- telephone number
- description of service requested and all other necessary information

### BATTERY INSTALLATION

Ensure the Model 3 range selector switch is in the OFF position. Open the battery lid by pushing down and turning the quarter turn thumbscrew counterclockwise a quarter of a turn. Install two "D" size batteries in the compartment.

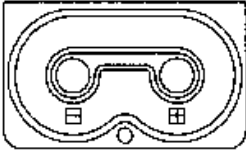

turn.

Note the (+) and (-) marks inside the battery door. Match the battery polarity to these marks. Close the battery box lid, push down and turn the quarter turn thumbscrew clockwise a quarter of a

#### Note:

The center post of a "D" size battery is positive.

### CONNECTING A DETECTOR TO THE INSTRUMENT

#### Caution!

The detector operating voltage is supplied to the detector via the detector input connector. A mild electric shock may occur if you make contact with the center pin of the input connector. Switch the Model 3 range selector switch to the OFF position before connecting or disconnecting the cable or detector.

Connect one end of a detector cable to the detector by firmly pushing the connectors together while twisting clockwise a quarter of a turn. Repeat the process in the same manner with the other end of the cable and the instrument.

### **BATTERY TEST**

Check the batteries daily or prior to use, whichever is less frequent, to assure proper operation of the instrument. Move the range multiplier switch to the BAT position. Ensure that the meter needle deflects to the battery check portion on the meter scale. If the meter does not respond, check to see if the batteries have been correctly installed. Replace the batteries if necessary.

### **INSTRUMENT TEST**

After checking the batteries, turn the instrument range switch to the  $\times 100$  position. Place the AUD ON-OFF switch in the ON position. Expose the detector to a check source. The instrument speaker should emit “clicks” relative to the rate of counts detected. The AUD ON-OFF switch will silence the audible clicks in the OFF position. When the instrument is not in use, the AUD ON-OFF switch should be kept in the OFF position in order to preserve battery life.

If the instrument has a cable connection to the radiation detector, the detector cable can be a source of problems. Test the detector cable by bending or flexing either end of the cable and checking for an increase in the rate of counts detected. Replace the cable if increases in the rate of counts are detected.

Check the meter reset function by depressing the RES pushbutton switch and ensuring the meter needle drops to 0.

Once this procedure has been completed, the instrument is ready for use.

### **READING THE METER FACE DIAL**

Reading the meter face is very important for consistent measurements. There are, in general, three types of meter faces:

- 1) count rate (typically counts per minute [cpm])
- 2) exposure rate (typically mR/hr)
- 3) combo (typically cpm and mR/hr)

The following examples are intended to help the user interpret the correct reading.

The normal procedure is to turn the range selector switch to the highest range, and if no readings are seen on the meter, turn the selector switch down to the lower scales until a reading is seen. The ranges on the instrument selector switch are multipliers for the meter reading. A typical single scale (one arc) meter face with a cpm (counts per minute) dial is shown below.

The count rate scale reads 0-5K counts per minute (kcpm or thousands of counts per minute) and has BAT TEST on the dial.



If the needle is pointing as indicated below and the instrument range selection switch is on the  $\times 0.1$  scale multiple, then the reading is 3.5 kcpm (multiplied by)  $\times 0.1 = 350$  cpm.



The same needle indications on successive ranges would be:

$$\times 1 = 3.5 \text{ kcpm (or 3500 cpm)}$$

$$\times 10 = 35 \text{ kcpm (or 35,000 cpm)}$$

$$\times 100 = 350 \text{ kcpm (or 350,000 cpm)}$$

A typical dual scale (two arcs) meter face is shown below. The top scale reads 0-2 mR/hr. The bottom scale also reads 0-2 mR/hr and is for  $\times 100$  only scale. The  $\times 100$  ONLY scale WILL work correctly when the multiplier switch is in the  $\times 100$  range. The meter face also has a BAT TEST position on the dial.



If the needle is pointing as indicated below and the range selection switch is on the  $\times 0.1$  scale, then the reading is 0.1 mR/hr.



The same needle indications on successive ranges would be:

$$\times 1 = 1.0 \text{ mR/hr (or 1000 } \mu\text{R/hr)}$$

$$\times 10 = 10 \text{ mR/hr (or } 10,000 \text{ } \mu\text{R/hr)}$$

$$\times 100 = 70 \text{ mR/hr (or } 70,000 \text{ } \mu\text{R/hr)}$$

The dial shown below has three arcs: a counts per minute scale (cpm), a linear mR/hr scale, and a non-linear mR/hr scale for the  $\times 100$  range only. The meter face also has a BAT TEST position.



The top cpm scale is valid for the  $\times 0.1$ ,  $\times 1$ ,  $\times 10$ , and the  $\times 100$  ranges. The linear (middle) mR/hr scale is valid for the  $\times 0.1$ ,  $\times 1$  and  $\times 10$  ranges. The non-linear mR/hr scale is valid for the  $\times 100$  range only. This meter face is commonly referred to as a “combo” meter face, since it has both, count rate (cpm) and exposure rate (mR/hr) arcs. Simpler meter faces may only have a count rate or an exposure rate arc(s) like the previous meter faces shown.

A combo meter face is specifically designed for a particular detector. In the example above, the 1.0 mR/hr mark on the middle arc lines up with 3.3 kcpm on the upper arc. The meter face in this example works with a detector that receives 3.3 kcpm per mR/hr (the Ludlum Model 44-9 pancake detector). Additional detectors may be used with this meter face, but only the cpm dial is valid for these detectors. The mR/hr scale is not valid for these additional detectors.

In the following picture, the needle is on the first tick mark past the 4-kcpm mark. Therefore, if the instrument selector switch is on the  $\times 0.1$  range, the reading is 4.2 kcpm (multiplied by)  $\times 0.1 = 420$  cpm.



The same needle indication on successive ranges would be:

$$\times 1 = 4.2 \text{ kcpm (or 4200 cpm)}$$

$$\times 10 = 42 \text{ kcpm (or 42,000 cpm)}$$

$$\times 100 = 420 \text{ kcpm (or 420,000 cpm)}$$

If you use the mR/hr scales, then the readings would be:

$$\times 0.1 = 0.13 \text{ mR/hr}$$

$$\times 1 = 1.3 \text{ mR/hr}$$

$$\times 10 = 13 \text{ mR/hr}$$

$$\times 100 = 130 \text{ mR/hr*}$$

**Note:**

\*This reading is using the bottom (non-linear) scale.

Many different dials are available, but each can be used as described above.

### OPERATIONAL CHECK

To assure proper operation of the instrument and detector(s) between calibrations, an instrument operational check including battery test and instrument test (as described on pages 2-2 and 2-3) should be performed at least daily or prior to use, whichever is less frequent. A reference reading (or readings) with a check source should be obtained with the detector(s) in a constant and reproducible manner at the time of calibration or at the time the instrument is received in the field.

If at any time the instrument fails to read within 20% of the reference reading when using the same check source, it should be sent to a calibration facility for recalibration and/or repair. If desired, multiple readings may be taken at different distances and/or with different sources so that other ranges or scales are checked.

## Specifications

---

High Voltage: adjustable from 400 to 1500 Vdc

Threshold: fixed at  $40 \text{ mV} \pm 10 \text{ mV}$

Response: toggle switch for fast (4 seconds) or slow (22 seconds) from 10% to 90% of final reading

Range: typically 0-200 mR/hr, or 0-500,000 cpm

Linearity: reading within 10% of true value with detector connected

Meter: 6.4 cm (2.5 in.) arc, 1 mA analog type

Meter Dial: 0-2 mR/hr, or 0-5k cpm, BAT TEST (others available)

## *Model 3 Survey Meter*

---

Multipliers:  $\times 0.1$ ,  $\times 1$ ,  $\times 10$ ,  $\times 100$

Calibration Controls: individual potentiometers for each range; accessible from front of instrument (protective cover provided)

End-of-Battery Life Warning: At 2.1 Vdc, the meter needle will drop to the edge of the bat test or bat ok area when the meter selector switch is moved to the bat position. At 2.0 Vdc, a steady audible tone will be emitted to warn the user of the low battery condition.

Battery Dependence: less than 3% change in readings to battery failure indication

Reset: pushbutton to zero the meter

Audio: built-in unimorph speaker with on-off switch (greater than 60 dB at 2 feet)

Connector: series "C" (others available)

Cable: one-meter (39-inch) with "C" connector (others available)

Power: two "D" cell batteries housed in a sealed externally accessible compartment.

Battery Life: typically greater than 2000 hours with alkaline batteries and with aud on-off switch in the off position

Size: 16.5 x 8.9 x 21.6 cm (6.5 x 3.5 x 8.5 in.) (H x W x L)

Weight: 1.6 kg (3.5 lb), including batteries

Construction: cast and drawn aluminum with beige powder coat

## **Identification of Controls and Functions**

---

See the Model 3 FRONT PANEL drawing at the beginning of this manual to reference the following controls:

**Meter:** 6.4 cm (2.5 in.) arc, 1 mA analog type with pivot-and-jewel suspension. Typical meter dials are 0-2 mR/hr, 0-20  $\mu$ Sv/h, 0-5k cpm or combination of exposure rates (0-2 mR/hr or 0-20  $\mu$ Sv/h) and cpm and BAT TEST.

**Connector:** Used to connect the detector to the instrument. Series "C" is typically used, but "BNC," "MHV," "UHF," or others can be used as well.

**Range Selector Switch:** A six-position switch marked OFF, BAT,  $\times 100$ ,  $\times 10$ ,  $\times 1$ ,  $\times 0.1$ . Turning the range selector switch from OFF to BAT provides the operator with a battery check of the instrument. A battery check scale on the meter provides a visual means of checking the battery charge status. Moving the range selector switch to one of the range multiplier positions ( $\times 100$ ,  $\times 10$ ,  $\times 1$ ,  $\times 0.1$ ) provides the operator with four decades of ranges. Multiply the scale reading by the multiplier to determine the actual scale reading.

**Calibration Controls:** Recessed potentiometers that are used to calibrate the individual range selections and allow for high voltage adjustment from 400 to 1500 volts. A protective cover is provided to prevent tampering.

**Battery Compartment:** Sealed compartment to house two "D" cell batteries.

**RESET Button:** When depressed, this switch provides a rapid means to drive the meter to zero.

**AUD ON-OFF Switch:** In the ON position, operates the unimorph speaker, located on the left side of the instrument.

The frequency of the clicks is relative to the rate of incoming pulses. The higher the rate, the higher the audio frequency. The audio should be turned OFF when not required, in order to reduce battery drain.

**Note:**

A low-battery condition results in a steady audio tone regardless of the position of the AUD ON-OFF switch.

F-S Toggle Switch: Provides meter response. Selecting the fast, "F" position of the toggle switch provides 90% of full-scale meter deflection in four seconds. In the slow, "S" position, 90% of full-scale meter deflection takes approximately 22 seconds. In the "F" position there is fast response and large meter deviation. The "S" position should be used for slow response and damped, meter deviation.

**Note:**

The slow response position is normally used when the instrument is displaying low numbers that require a more stable meter movement. The fast response position is used at high rate levels.

## **Safety Considerations**

---

### **ENVIRONMENTAL CONDITIONS FOR NORMAL USE**

Indoor or outdoor use

No maximum altitude (the detector may be affected by altitude, refer to the detector manual for more information.)

Temperature range of -20 to 50 °C (-4 to 122 °F). May be certified for operation from -40 to 65 °C (-40 to 150 °F).

Maximum relative humidity of less than 95% (non-condensing)

Pollution Degree 3 (as defined by IEC 664). (Occurs when conductive pollution or dry nonconductive pollution becomes conductive due to condensation. This is typical of industrial or construction sites.)

Water resistance is achieved by the use of rubber seals on all front-panel switches and gaskets on the battery lid, meter bezel, and between the instrument can and front panel.

## WARNING MARKINGS AND SYMBOLS

### Caution!

The operator or responsible body is cautioned that the protection provided by the equipment may be impaired if the equipment is used in a manner not specified by Ludlum Measurements, Inc.

The Model 3 Survey Meter is marked with the following symbols:



CAUTION, RISK OF ELECTRIC SHOCK (per ISO 3864, No. B.3.6) – designates a terminal (connector) that allows connection to a voltage exceeding 1 kV.

Contact with the subject connector while the instrument is on or shortly after turning off may result in electric shock. This symbol appears on the front panel.



CAUTION (per ISO 3864, No. B.3.1) – designates hazardous live voltage and risk of electric shock.

During normal use, internal components are hazardous live. This instrument must be isolated or disconnected from the hazardous live voltage before accessing the internal components. This symbol appears on the front panel. Note the following precautions:

**Warning!**

The operator is strongly cautioned to take the following precautions to avoid contact with internal hazardous live parts that are accessible using a tool:

1. Turn the instrument power off and remove the batteries.
2. Allow the instrument to sit for one minute before accessing internal components.



The “crossed-out wheellie bin” symbol notifies the consumer that the product is not to be mixed with unsorted municipal waste when discarding; each material must be separated. The symbol is placed on the battery compartment lid. See Recycling for further information.



The “CE” mark is used to identify this instrument as being acceptable for use within the European Union.

**CLEANING AND MAINTENANCE PRECAUTIONS**

The Model 3 may be cleaned externally with a damp cloth, using only water as the wetting agent. Do not immerse the instrument in any liquid. Observe the following precautions when cleaning or performing maintenance on the instrument:

1. Turn the instrument OFF and remove the batteries.
2. Allow the instrument to sit for one minute before cleaning the exterior or accessing any internal components for maintenance.

## Calibration and Maintenance

---

### CALIBRATION

Calibration controls are located on the front of the instrument under the calibration cover. The controls may be adjusted with a 0.32 cm (one-eighth inch) blade screwdriver.

**Note:**

Local procedures may supersede the following

---

The instrument may be calibrated using exposure rate calibration or cpm calibration, (both methods are described below.) Unless otherwise specified, the instrument is calibrated to exposure rate at the factory.

**Note:**

Measure high voltage with a Model 500 pulser or a high-impedance voltmeter with a high-meg probe. If one of these instruments is not available, use a voltmeter with a minimum of 1000 megohm input resistance.

---

Calibration shall include response evaluations and adjustment for two points of each scale of the instrument. The points should be separated by at least 40% of the full-scale value and should be represented by points of approximately equal distance from the mid-point of the scale. For example, 25% and 75%, or 20% and 80% could be used.

➤ **EXPOSURE RATE CALIBRATION**

Connect the input of the instrument to a negative pulse generator, such as a Ludlum Model 500 Pulser.

### Caution!

The instrument input operates at a high potential. Connect the pulse generator through a  $0.01\mu\text{F}$ , 3000-volt capacitor, unless the pulse generator is already protected.

Adjust the HV control for the proper operation voltage of the detector to be used. Disconnect the pulser and connect the detector to the instrument.

Turn the range selector switch to the  $\times 100$  position. Expose the detector to a calibrated gamma field, which corresponds to approximately 80% of full-scale meter deflection. Adjust the  $\times 100$  calibration control for the proper reading.

Reposition the detector so the field corresponds to approximately 20% of full-scale meter deflection. Confirm that the meter reading is within 10% of the field.

Repeat this process for the  $\times 10$ ,  $\times 1$ , and  $\times 0.1$  ranges.

If your gamma exposure range cannot calibrate two positions on each scale, the pulser may be used to “electronically calibrate” the remaining points. Reconnect the pulser to the instrument and determine the count rate conversion at a previous range calibration point. Then use that conversion rate to calibrate other points or scales.

If, for example, you can exposure rate calibrate the  $400\ \mu\text{R/hr}$  point, but not the  $40\ \mu\text{R/hr}$  point, first use the pulser to get the count rate equivalent to the calibrated  $400\ \mu\text{R/hr}$  point. Then switch the pulser multiplier switch to the next lower setting, and adjust the appropriate calibration control on the Model 3 for the meter to read  $40\ \mu\text{R/hr}$ .

### ➤ CPM CALIBRATION

Connect the input of the instrument to a negative pulse generator, such as a Ludlum Model 500 Pulser.

#### Caution!

The instrument input operates at a high potential. Connect the pulse generator through a  $0.01\mu\text{F}$ , 3000-volt capacitor, unless the pulse generator is already protected

Adjust the HV control for the proper operating voltage of the detector to be used. Adjust the pulser negative pulse frequency to provide a meter deflection of approximately 80% of full-scale on the  $\times 100$  range. Adjust the  $\times 100$  calibration control for the proper reading.

Check the 20% scale indication of the Model 3 by reducing the Pulser count rate by a factor of 4. The Model 3 should read within 10% of the actual pulse rate. Decrease the pulse rate of the Model 500 by one decade and turn the Model 3 range selector to the next lower range. Repeat the above procedure for the remaining lower ranges.

#### Note:

In the event that any reading is not within 10% of the true value on any scale after any of the above calibration methods is performed, a reading within 20% of true value shall be acceptable. It is acceptable if a calibration graph or chart is provided with the instrument. Instruments that cannot meet these criteria are defective and require repair.

### ➤ ESTABLISHING AN OPERATING POINT

The operating point for the instrument and detector is established by setting the instrument high voltage (HV). The proper selection of this point is the key to instrument performance. Efficiency, background sensitivity, and noise are fixed by the physical makeup of the given detector and rarely vary from unit to unit. However, the selection of the operating point makes a marked difference in the apparent contribution of these three sources of count.

In setting the operating point, the result of the adjustment is to establish the system gain so that the desirable signal pulses (including background) are above the discrimination level, and the unwanted pulses from noise are below the discrimination level and are therefore not counted. The system gain is controlled by adjusting the high voltage.


#### Note:

Measure the high voltage with a Ludlum Model 500 Pulser. If the Pulser does not have a high-voltage readout, use a high-impedance voltmeter with at least 1000 megohm input resistance to measure the high voltage.

**GM Detectors:** In the special case of GM detectors, a minimum voltage must be applied to establish the Geiger-Mueller characteristic. The output pulse height of the GM detector is not proportional to the energy of the detected radiation. Most GM detectors operate at 900 volts, although some miniature detectors operate at 400-500 volts.

Refer to the detector operating manual for specific recommendations. If a recommended setting is unavailable, plot an HV-versus-count-rate curve to produce a plateau graph similar to the one displayed below. Adjust the HV for 25-50 volts above the knee or start of the plateau. For mixed detector use, the high voltage may be tallied for both, as long as the GM detector is operated within the recommended voltage range.

Scintillators: Scintillation type detectors have a wide gain spectrum, typically 1000:1 at a single operating point. An operating-voltage-versus-count-rate curve (plateau) must be established to determine the proper operating voltage. The operating voltage is typically set above the knee of the plateau. Plot the HV-versus-background and source count to produce a plateau graph similar to the one in the figure below. Adjust the HV to 25-50 volts above the knee or start of the plateau. This provides the most stable operating point for the detector.

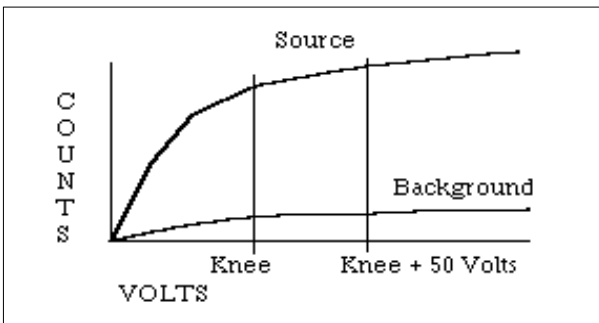

**Note:**

If more than one detector is to be used with the instrument and the operating voltages are different, the HV will have to be readjusted for each detector substitution.

### MAINTENANCE

Instrument maintenance consists of keeping the instrument clean and periodically checking the batteries and the calibration. The Model 3 instrument may be cleaned with a damp cloth (using only water as the wetting agent). Do not immerse instrument in any liquid. Observe the following precautions when cleaning:

1. Turn the instrument OFF and remove the batteries.
2. Allow the instrument to sit for one minute before accessing internal components.

#### ➤ RECALIBRATION

Recalibration is required after any repairs or adjustments have been made to the instrument. Recalibration is not normally required following instrument cleaning, battery replacement, or detector cable replacement.

#### Note:

Ludlum Measurements, Inc. recommends recalibration at intervals no greater than one year. Check the appropriate regulations to determine required recalibration intervals.

Ludlum Measurements offers a full-service repair and calibration department. We not only repair and calibrate our own instruments but most other manufacturer's instruments.

Calibration procedures are available upon request for customers who choose to calibrate their own instruments.

➤ **BATTERIES**

The batteries should be removed any time the instrument is placed into storage. Battery leakage may cause corrosion on the battery contacts, which must be scraped off and/or washed using a paste solution made from baking soda and water. Use a spanner wrench to unscrew the battery contact insulators, exposing the internal contacts and battery springs. Removal of the handle will facilitate access to these contacts.

**Note:**

Never store the instrument over 30 days without removing the batteries. Although this instrument will operate at very high ambient temperatures, battery seal failure may occur at temperatures as low as 37.8 °C (100 °F).

## Troubleshooting

---

Occasionally, you may encounter problems with your LMI instrument or detector that may be repaired or resolved in the field, saving turnaround time and expense in returning the instrument to us for repair. Toward that end, LMI electronics technicians offer the following tips for troubleshooting the most common problems. Where several steps are given, perform them in order until the problem is corrected. Keep in mind that with this instrument, the most common problems encountered are: 1) detector cables, 2) sticky meters, and 3) battery contacts.

Note that the first troubleshooting tip is for determining whether the problem is with the electronics or with the detector. A Ludlum Model 500 Pulser is invaluable at this point, because of its ability to simultaneously check high voltage, input sensitivity or threshold, and the electronics for proper counting.

We hope these tips will prove to be helpful. As always, please call if you encounter difficulty in resolving a problem or if you have any questions.

### **TROUBLESHOOTING ELECTRONICS WHICH UTILIZE A G-M DETECTOR OR SCINTILLATOR**

<b><u>SYMPTOM</u></b>	<b><u>POSSIBLE SOLUTION</u></b>
no power (or meter does not reach BAT TEST or BAT OK mark)	<ol style="list-style-type: none"><li>1. Check batteries and replace if weak.</li><li>2. Check polarity (See marks inside batter lid). Are the batteries installed backwards?</li></ol>

**SYMPTOM**

**POSSIBLE SOLUTION**

no power (or meter does not reach BAT TEST or BAT OK mark) (continued)

3. Check battery contacts. Clean them with rough sandpaper or use an engraver to clean the tips.
4. Remove the can and check for loose or broken wires.

nonlinear readings

1. Check the high voltage (HV) using a Ludlum Model 500 Pulser (or equivalent). If a multimeter is used to check the HV, ensure that one with high impedance is used, as a standard multimeter could be damaged in this process.
2. Check for noise in the detector cable by disconnecting the detector, placing the instrument on the lowest range setting, and wiggling the cable while observing the meter face for significant changes in readings.

**SYMPTOM**

**POSSIBLE SOLUTION**

nonlinear readings (continued)

3. Check for “sticky” meter movement. Does the reading change when you tap the meter? Does the meter needle “stick” at any spot?
4. Check the “meter zero.” Turn the power OFF. The meter should come to rest on “0”.

meter goes full scale or “pegs out”

1. Replace the detector cable to determine whether the cable has failed, causing excessive noise.
2. Check the HV, and if possible, the input threshold for proper setting.
3. Remove the can and check for loose or broken wires.
4. Ensure that the instrument’s “can” is properly attached. When attached properly, the speaker will be located on the left side of the instrument. If the can is on backwards, interference

**SYMPTOM**

**POSSIBLE SOLUTION**

	between the speaker and the input preamplifier may cause noise.
no response to radiation	<ol style="list-style-type: none"><li>1. Substitute a “known good” detector and/or cable.</li><li>2. Has the correct operating voltage been set? Refer to the calibration certificate or detector instruction manual for correct operating voltage. If the instrument uses multiple detectors, confirm that the high voltage is matched to the current detector being used.</li></ol>
no audio	<ol style="list-style-type: none"><li>1. Ensure that the AUD ON-OFF switch is in the ON position.</li><li>2. Remove the instrument housing and check the connection between the circuit board and the speaker. Plug in the 2-pin connector if necessary.</li></ol>

## **TROUBLESHOOTING GM DETECTORS**

1. If the tube has a thin mica window, check for window breakage. If damage is evident, the tube must be replaced.
2. Check the HV. For most GM tubes, the voltage is normally 900 Vdc, or 460-550 Vdc for “peanut” tubes (Ludlum Model 133 series).
3. If the input sensitivity is too low, the user could see some double pulsing (where the instrument “counts” a single pulse from the detector multiple times.)
4. Wires to the tube may be broken, or the crimped connector could have a loose wire.

## **TROUBLESHOOTING SCINTILLATORS**

1. Alpha or alpha/beta scintillators are prone to light leaks. They can be tested for this problem in a dark room or with a bright light. If a light leak is determined, changing the Mylar window assembly will usually fix the problem.
2. Verify that the HV and input sensitivity are correct. Alpha and gamma scintillators typically operate from 10-35 mV. High voltage varies with the photomultiplier tubes (PMT) from as low as 600 Vdc, to as high as 1400 Vdc.
3. On a gamma scintillator, visually inspect the crystal for breakage or humidity leakage. Water inside the crystal will turn it yellow and gradually degrade performance.
4. Check the PMT to see if the photocathode still exists.

If the end of the PMT is clear (not brownish), this indicates a loss of vacuum, which will render the PMT useless.

## Technical Theory of Operation

---

### LOW VOLTAGE SUPPLY

Battery voltage is coupled to U11 and associated components (a switching regulator) to provide 5 volts at pin 8 to power all logic circuits. A voltage divider (R27 and R32) located at pin 1 of U11 sets the end-of-battery-life squeal at 2.0 Vdc. Components R12 and C30 provide filtering to create +5 VA used by the amplifier and discriminator circuits.

### HIGH VOLTAGE SUPPLY

High voltage is developed by pulses from the switching regulator U13 to transformer T1. High voltage is multiplied by the ladder network of diodes CR3 through CR7 and capacitors C18 through C27. High voltage is coupled back through R39 to pin 8 of U13. High voltage output is set by front-panel potentiometer R42, which sets the voltage feedback of 1.31 Vdc to pin 8 of U13. R38 and C28 provide filtering.

### DETECTOR INPUT

Detector pulses are coupled from the detector through C6 to amplifier input pin 2 of U4. CR1 protects U4 from input shorts. R37 couples the detector to the high voltage supply.

### AMPLIFIER

A self-biased amplifier provides gain in proportion to R15 divided by R14, with some gain loss due to feedback capacitor C4. A transistor (pin 3 of U4) provides amplification. U6 is configured as a constant current source to pin 3 of U4. The output self-biases to 2 Vbe (approximately 1.4 volts) at the

emitter of Q1. This provides just enough bias current through pin 3 of U4 to conduct all of the current from the current source. Positive pulses from the emitter of Q1 are coupled to the discriminator.

### **DISCRIMINATOR**

Comparator U8 provides discrimination. The discriminator is set by a voltage divider (R21 and R23), coupled to pin 3 of U8. As the amplified pulses at pin 4 of U8 increase above the discriminator voltage, 5-volt negative pulses are produced at pin 1 of U8. These pulses are coupled to pin 5 of U9 for meter drive and pin 12 of U9 for audio.

### **AUDIO**

Discriminator pulses are coupled to univibrator pin 12 of U9. The front-panel audio ON-OFF selector controls the reset at pin 13 of U9. When ON, pulses from pin 10 of U9 turn on oscillator U12, which drives the housing-mounted unimorph speaker. Speaker tone is set by R31 and C14. Tone duration is controlled by R22 and C7.

### **SCALE RANGING**

Detector pulses from the discriminator are coupled to univibrator pin 5 of U9. For each scale, the pulse width of pin 6 of U9 is changed by a factor of 10 with the actual pulse width being controlled by the front panel switch, the analog switches U1 and U2, and the related potentiometers. This arrangement allows the same current to be delivered to C9 by 1 count on the  $\times 0.1$  range as 1000 counts on the  $\times 100$  range.

### **METER DRIVE**

Pulses from pin 6 of U9 charge capacitor C9. A constant current driver (op amp U10 and transistor Q2) delivers proportional current to the meter. For battery test (BAT

TEST), the meter is directly coupled by the analog switch U3 to the batteries through resistor R8.

### **METER RESET**

Ratemeter reset is initiated by changing the voltage differential at C9 to 0 when the RESET button is depressed.

### **FAST/SLOW TIME CONSTANT**

For the slow time constant, C17 is switched from the output of the meter drive to parallel C9.

## **Recycling**

---

**L**udlum Measurements, Inc. supports the recycling of the electronic products it produces for the purpose of protecting the environment and to comply with all regional, national, and international agencies that promote economically and environmentally sustainable recycling systems. To this end, Ludlum Measurements, Inc. strives to supply the consumer of its goods with information regarding reuse and recycling of the many different types of materials used in its products. With many different agencies – public and private – involved in this pursuit, it becomes evident that a myriad of methods can be used in the process of recycling. Therefore, Ludlum Measurements, Inc. does not suggest one particular method over another, but simply desires to inform its consumers of the range of recyclable materials present in its products, so that the user will have flexibility in following all local and federal laws.

The following types of recyclable materials are present in Ludlum Measurements, Inc. electronic products, and should be recycled separately. The list is not all-inclusive, nor does it suggest that all materials are present in each piece of equipment:

- Batteries
- Glass
- Aluminum and Stainless Steel
- Circuit Boards
- Plastics
- Liquid Crystal Display (LCD)

Ludlum Measurements, Inc. products that have been placed on the market after August 13, 2005 have been labeled with a symbol recognized internationally as the “crossed-out wheelie bin.” This notifies the consumer that the product is not to be mixed with unsorted municipal waste when discarding; each material must be separated. The symbol will be placed near the AC receptacle, except for portable equipment where it will be placed on the battery lid.

The symbol appears as such:



## **Parts List**

---

Model 3 Survey Meter

<u>Reference</u>	<u>Description</u>	<u>Part Number</u>
------------------	--------------------	--------------------

### **Main Board, Drawing 464 × 204**

UNIT	Completely Assembled Model 3 Survey Meter	48-1605
BOARD	Completely Assembled Main Circuit Board	5464-204
CAPACITORS:		
C1	47pF, 100V	04-5660
C2	0.1μF, 35V	04-5755
C3	0.0047μF, 100V	04-5669
C4	10pF, 100V	04-5673
C5	0.01μF, 50V	04-5664
C6	100pF, 3KV	04-5735
C7	0.022μF, 50V	04-5667
C8	1μF, 16V	04-5701
C9	10μF, 25V	04-5655
C10	100pF, 100V	04-5661
C11	68μF, 10V	04-5654
C12	10μF, 25V	04-5728
C14	470pF, 100V	04-5668
C15	220pF, 100V	04-5674
C16	68μF, 10V	04-5654
C17	47μF, 10V	04-5666
C18-C27	0.01μF, 500V	04-5696

## Model 3 Survey Meter

---

C28	0.001 $\mu$ F, 2KV	04-5703
	or 100pF, 3KV	04-5735
C29	10 $\mu$ F, 25V	04-5655
C30-C31	1 $\mu$ F, 16V	04-5701
C32	470pF, 100V	04-5668

### TRANSISTORS:

Q1	MMBT3904LT1	05-5841
Q2	MMBT4403LT1	05-5842
<u>Reference</u>	<u>Description</u>	<u>Part Number</u>

### INTEGRATED CIRCUITS:

U1-U3	MAX4542ESA	06-6453
U4-U5	CMXT3904	05-5888
U6	CMXT3906	05-5890
U7	MAX4541ESA	06-6452
U8	MAX985EUK-T	06-6459
U9	CD74HC4538M	06-6297
U10	LMC7111BIM5X	06-6410
U11	LT1304CS8-5	06-6434
U12	MIC1557BM5	06-6457
U13	LT1304CS8	06-6394

### DIODES:

CR1	CMPD2005S	07-6468
CR2	RECTIFIER CMSH1-40M	07-6411
CR3-CR7	CMPD2005S	07-6468
CR9	RECTIFIER CMSH1-40M	07-6411

### SWITCHES:

SW1	D5G0206S-9802	08-6761
SW2	TP11LTCQE	08-6770
SW3-SW4	7101SDCQE	08-6781

## *Model 3 Survey Meter*

---

### POTENTIOMETERS:

R33	250K, 64W254, ×100	09-6819
R34	250K, 64W254, ×10	09-6819
R35	500K, 64W504, ×1	09-6850
R36	250K, 64W254, ×0.1	09-6819
R42	1.2M, 3296W, HV	09-6814

### RESISTORS:

R1-R5	200K, 1/8W, 1%	12-7992
R6	8.25K, 1/8W, 1%	12-7838
R7	10K, 1/8W, 1%	12-7839
R8	2.37K, 1/8W, 1%	12-7861
R9-R11	10K, 1/8W, 1%	12-7839
R12	200 Ohm, 1/8W, 1%	12-7846
R13	10K, 1/8W, 1%	12-7839
R14	4.75K, 1/8W, 1%	12-7858
R15	200K, 1/8W, 1%	12-7992
R16	10K, 1/8W, 1%	12-7839
R17	1K, 1/8W, 1%	12-7832
R18	4.75K, 1/8W, 1%	12-7858
R19	2K, 1/8W, 1%	12-7926
R20-R21	100K, 1/8W, 1%	12-7834
R22	1M, 1/8W, 1%	12-7844
R23	2.49K, 1/8W, 1%	12-7999
R24	14.7K, 1/8W, 1%	12-7068
R25	200K, 1/4W, 1%	12-7992
R26	100K, 1/4W, 1%	12-7834
R27	68.1K, 1/8W, 1%	12-7881
R28	100K, 1/8W, 1%	12-7834
R29	1K, 1/8W, 1%	12-7832
R30	100K, 1/8W, 1%	12-7834
R31	475K, 1/8W, 1%	12-7859
R32	100K, 1/8W, 1%	12-7834
R37	100K, 1/8W, 1%	12-7834

## Model 3 Survey Meter

---

R38	2.2M, 1/8W, 1%	12-7002
R39	500M, 3KV, 2%	12-7031
R40	402K, 1/8W, 1%	12-7888
R44	1K, 1/4W, 1%	12-7832

### CONNECTORS:

P1	640456-5 - MTA100	13-8057
P2	640456-6 - MTA100 (installed as required)	13-8095
P3	640456-2 - MTA100	13-8073

### INDUCTOR:

L1	22 $\mu$ H	21-9808
----	------------	---------

### TRANSFORMER:

T1	31032R	21-9925
----	--------	---------

## Wiring Diagram, Drawing 464 $\times$ 212

### CONNECTORS:

J1	MTA100 $\times$ 5, MAIN BOARD 5464-204	13-8140
J2	OPTIONAL (M3 overload) MTA100 $\times$ 6, 5464-204	13-8171
J3	MTA100 $\times$ 2, MAIN BOARD 5464-204	13-8178

### AUDIO:

DS1	UNIMORPH TEC3526-PU	21-9251
-----	---------------------	---------

### BATTERIES:

B1-B2	"D" DURACELL BATTERY	21-9313
-------	----------------------	---------

## Model 3 Survey Meter

---

### MISCELLANEOUS:

*	PORTABLE BATTERY CONTACT ASSEMBLY	2001-042
*	MODEL 3 CASTING	7464-219
*	MODEL 3 MAIN HOUSING	8464-035
*	PORTABLE CAN ASSEMBLY (MTA)	4363-441
*	PORTABLE KNOB	08-6613
<u>Reference</u>	<u>Description</u>	<u>Part Number</u>
M1	METER ASSEMBLY METER BEZEL W/GLASS W/O SCREWS	4363-188
*	METER MOVEMENT (1mA)	15-8030
*	PORTABLE METER FACE	7363-136
*	HARNESS-PORT CAN WIRES	8363-462
*	BATTERY LID W/O LATCH KIT MODEL 3	2363-191
*	PORTABLE LATCH KIT W/O BATTERY LID	4363-349
*	PORTABLE HANDLE(GRIP) W/SCREWS	4363-139
*	PORTHANDLE FOR CLIP W/SCREWS	4363-203
*	REPLACEMENT CABLE (STD 1 meter [39 inches])	40-1004
*	CLIP (44-3 TYPE) W/SCREWS	4002-026-01
*	CLIP (44-6 TYPE) W/SCREWS	4010-007-01
*	LABEL-M3 CALIBRATION	2310602
*	LABEL-M3 BATTERY LID	2310601
*	LABEL-M3 FACEPLATE	2310603

## **Drawings and Diagrams**


---

MAIN CIRCUIT BOARD, Drawing 464 × 204 (3 sheets) located in  
Center Insert

MAIN CIRCUIT BOARD LAYOUT, Drawing 464 × 205 (2 sheets)

CHASSIS WIRING DIAGRAM, Drawing 464 × 212

Model 3 Main Circuit Board Layout, Drawing 464 × 205 Sheet 1

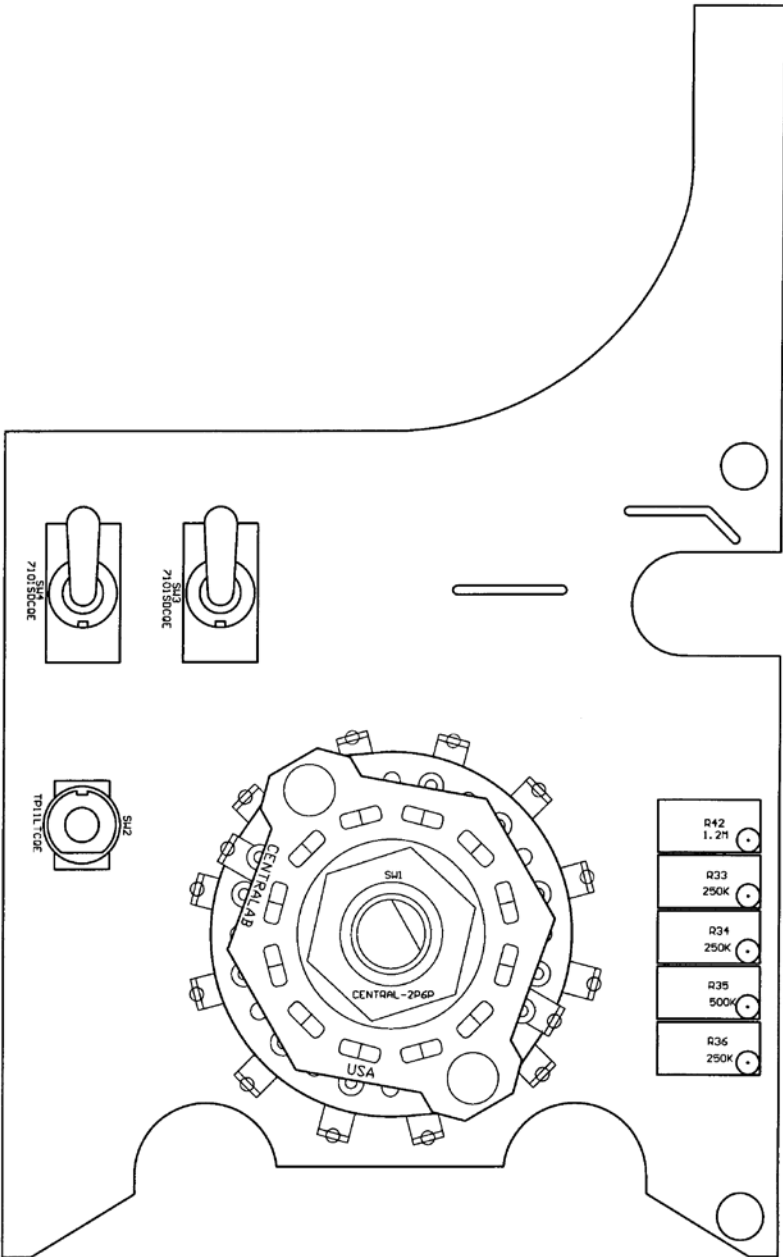



Model 3 Main Wiring Diagram Drawing 464 × 212

